



LUK 0561

SERVICE INFO

Installation notice

Release mechanism issues


Manufacturers: Honda

Models : Accord 2004>2008,
 CRV 2002>2005

Engines: 2.2CTDi

With the vehicles listed above the clutch pedal height and free play must be set correctly. If not problems may occur with either release bearing noise or clutch slip. To set the pedal correctly;

- Remove driver's side floor mat.
- Back off pedal position switch (a).
- Adjust clutch push rod (b) to achieve the specified heights; free play, pedal height and stroke.
- With the pedal released, adjust the pedal position switch (a) until it contacts the pedal.
- Adjust the pedal position switch (a) in an additional $\frac{3}{4}$ to 1 turn.
- Adjust the pedal position switch (c) to activate at a height of 90.5mm (Accord) or 10-16mm (CRV) from the floor.

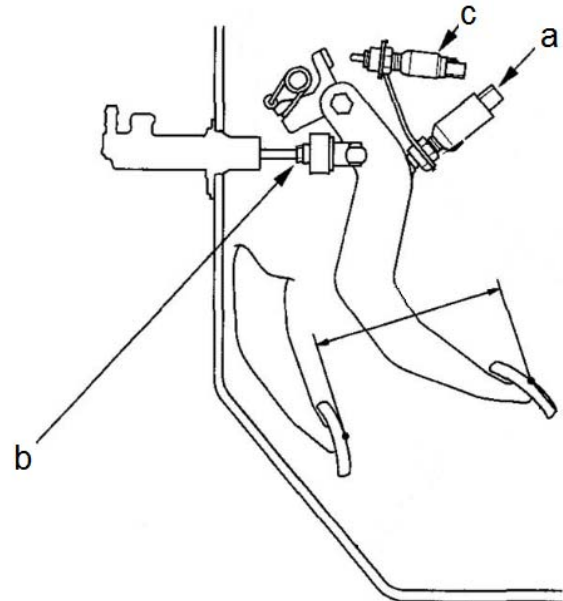

Accord ;
Pedal free play 10-18mm
Pedal height 183mm
Pedal stroke 130-140mm

CRV ;
Pedal free play 6-7mm
Pedal height 200mm
Pedal stroke 200mm

- For accurate model information please see the Schaeffler online catalogue
- Die genaue Fahrzeugzuordnung entnehmen Sie bitte dem Schaeffler- Katalog
- Pour plus d'information sur les applications veuillez vous référer au catalogue Schaeffler
- Para obtener información sobre el modelo, rogamos consulte el catálogo de Schaeffler
- Per informazioni sul modello consultare il catalogo Schaeffler

REXPERT Hotline: +44 (0) 1432 264264

Fax : +44 (0) 1432 375 760

E-Mail: aftermarket.uk@schaeffler.com

www.rexpert.co.uk